


ITEM	Qty -041	Part Number	Description
	X	D3582-041	SKIDTUBE ASSEMBLY
1	1	D2962-150	EXTRUSION
2	1	D2964	CAP
3	1	D2965	CAP
4	1	D2971	CROSS BOLT SPACER
5	1	D3508-3	WEARPLATE
6	1	D3508-9	WEARPLATE
7	1	D3508-11	WEARPLATE
8	1	D3508-13	WEARPLATE
9	1	D3558-3	GASKET
10	1	D3558-9	GASKET
11	1	D3558-11	GASKET
12	1	D3558-13	GASKET
13	1	D3584-1	WEB
14	3	D3662-1	CROSS BOLT SPACER
15	1	D3662-3	CROSS BOLT SPACER
16	2	D5304-1	CROSS BOLT SPACER
17	2	D5520-1	DOUBLER
18	28	AN3C4A	BOLT
19	2	AN3-5A	BOLT
20	2	AN4-4A	BOLT
21	28	NAS1149C0332R	WASHER (AN960C10L)
22	2	NAS1149D0332J	WASHER (AN960JD10L)
23	2	NAS1149D0416J	WASHER (AN960JD416L)
24	36	AELS-1032-130	INSERT
25	2	ALS7-428-165	INSERT
26	68	CR3212-5-05	CSK RIVET, CHERRY MAX

NOTES:

- 1) MATERIAL: N/A
2) FINISH: CHEMICAL CONVERSION COAT PER QSI 005 4.1 PRIOR TO INSERTING D3584-1 WEB.
POWDER COAT ASSEMBLY GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3.
ANTI-SKID PAINT AS INDICATED TO 1.00 ABOVE CENTER LINE PER DART QSI 005 4.4
3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
4) UNITS: INCHES UNLESS OTHERWISE NOTED.
5) BREAK SHARP EDGES: N/A
6) IDENTIFICATION: N/A
7) WEIGHT: 18.2 lbs
8) WELDING: PER DART QSI 004.
9) INSERT D3584-1 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL
SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015 AFTER BENDING.
10) USE DART DRILL TEMPLATE DT8900 TO LOCATE AND DRILL Ø0.297 HOLES (36 PLACES) FOR WEARSHOE INSERTS. INSTALL
AELS-1032-130 PER SECTION G-G (36 PLACES) AFTER FINISH. SEAL WEARPLATE BOLTS WITH SIKAFLEX-241/-291.
11) DO NOT INSTALL AN3C4A BOLTS AND NAS1149C0332R WASHERS IN INDICATED LOCATIONS
12) LOCATE QTY (34) HOLES ONTO THE SKIDTUBE PER D5520-1 DOUBLER AND DRILL Ø0.161 THRU SKIDTUBE AND DOUBLER USING DT10309.
COUNTERSINK Ø0.286 x 100° (34 PL) PER DOUBLER AND INSTALL EACH D5520-1 DOUBLER USING QTY (34) CR3212-5-05 CSK RIVETS.


RELEASED
2017-08-11
EN 17-547

E	MOVE VIEWS FROM SHT 1 TO SHT 2. ADD ITEMS 17 & 26 AND NOTE 12-13. Ø0.187 HOLE WAS Ø0.75. ADD SHT 3, ADD DETAIL J. SECTION F-F ADD D5520-1. SCALE ON VIEWS WAS 3X.	AJS	17.03.27
D	D5304-1 WAS D2973; REVISE BOM & SECTION F-F & SECTION NOTES (ZN B7-3, A8-3); REF NCR16-6160	RF	17.01.09
C	D3492 PLUG ASSEMBLIES REMOVED. REFORMAT NOTES SHT 1	AP	15.11.02
B	29.86 WAS 29.87 (ZN C2-1), INCORPORATED DEO D3582-A-1 (ZN D5-1), FORMAT TO CURRENT STD	RF	15.02.20
A	NEW ISSUE	PH	07.06.08
REV.	DESCRIPTION	BY	DATE
DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	EUGENE, OR	
CHECKED	Mike	DRAWING NO.	REV. E
MFG. APPR.	DP	D3582	SHEET 1 OF 4
APPROVED	DP	TITLE	SCALE
DE APPR.	DP	BK 117 SKIDTUBE ASSEMBLY	NTS
DATE	17.03.27	COPYRIGHT © 2007 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

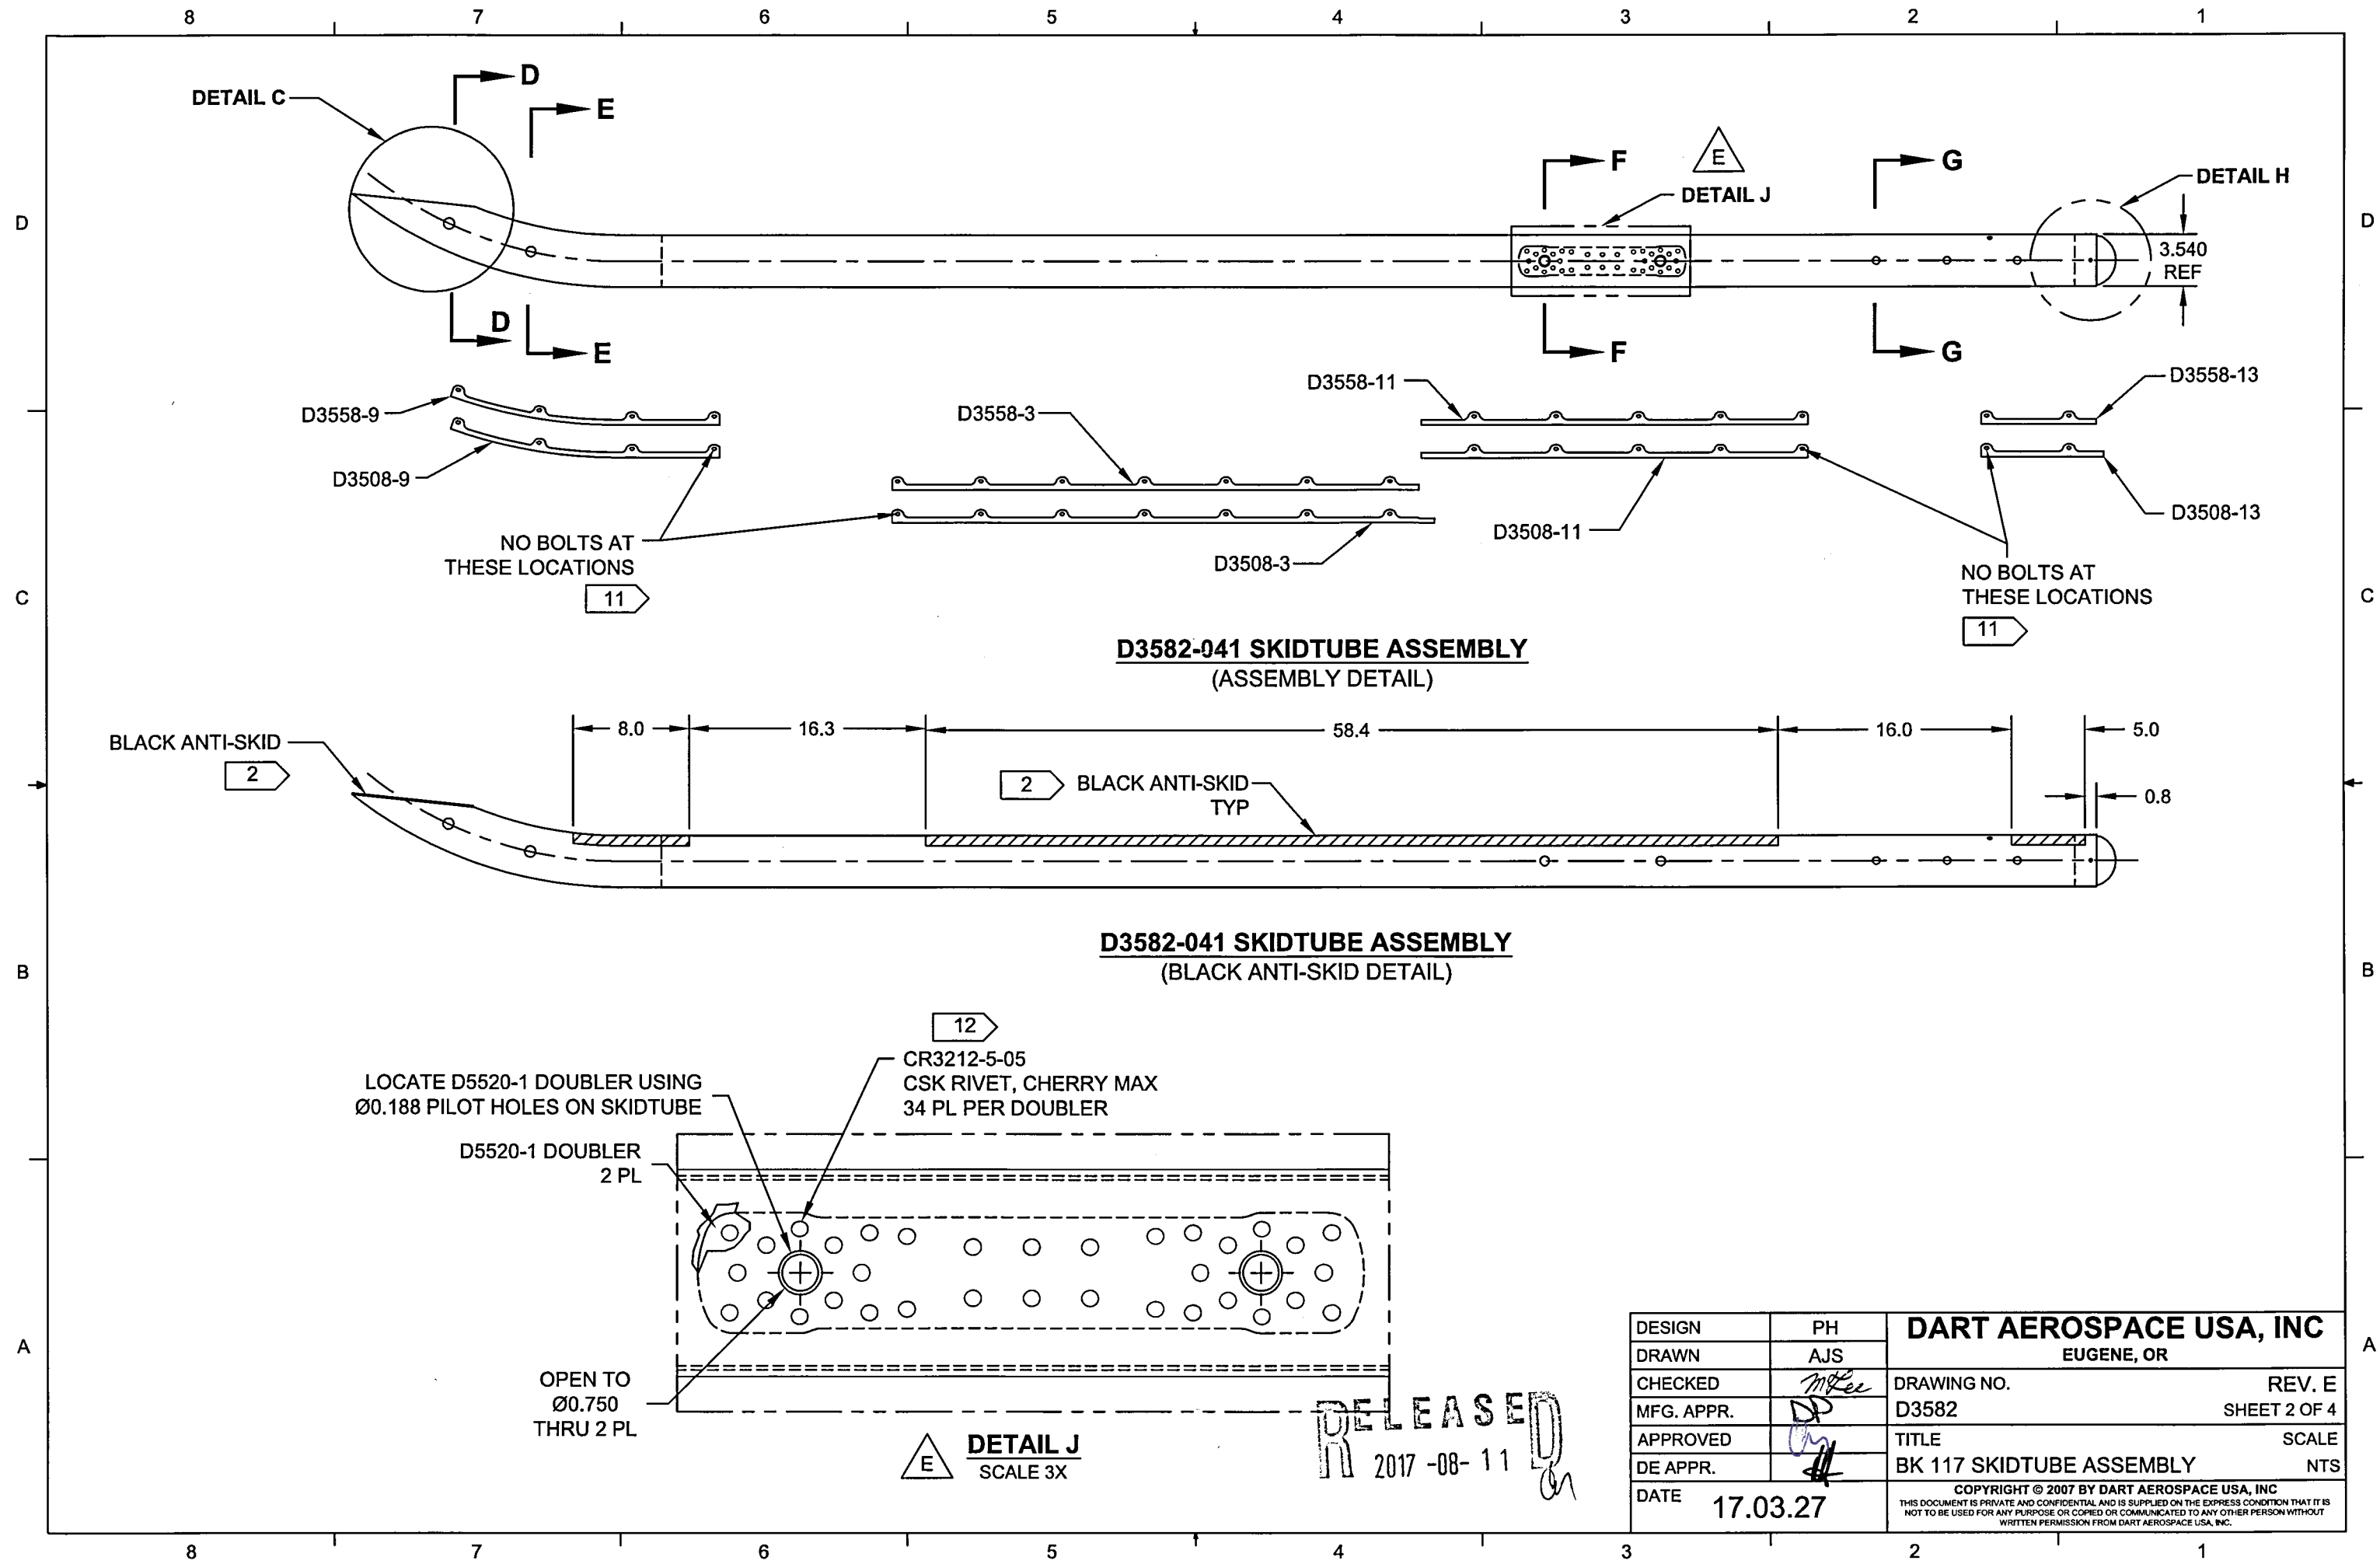


DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	EUGENE, OR	
CHECKED	<i>M. Lee</i>	DRAWING NO.	REV. E
MFG. APPR.	<i>DP</i>	D3582	SHEET 2 OF 4
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	BK 117 SKIDTUBE ASSEMBLY	NTS
DATE	17.03.27	COPYRIGHT © 2007 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

8 7 6 5 4 3 2 1

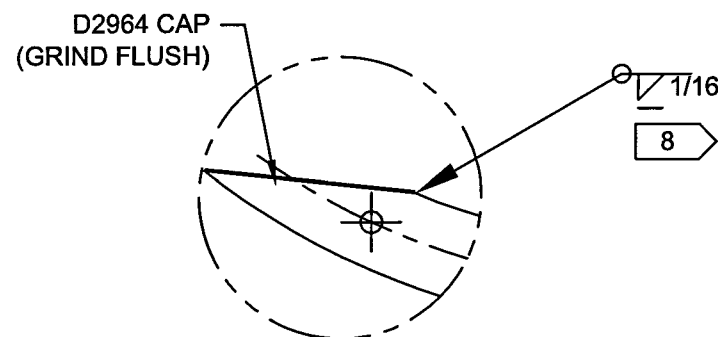


DETAIL C
SCALE 4X

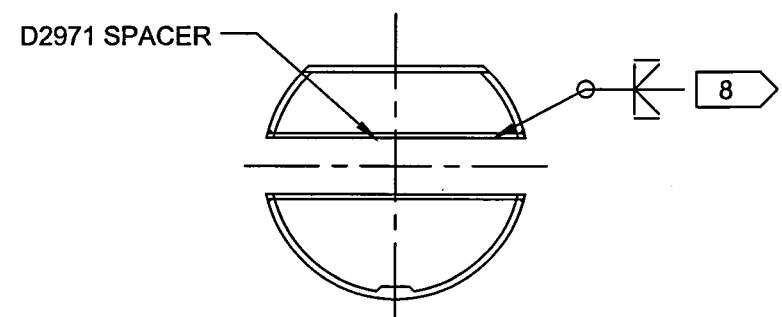


SECTION D-D
SCALE 4X

- SECTION D-D NOTES**
AFTER BENDING AND DRILLING ASSEMBLY
PERFORM THE FOLLOWING:
1. CHAMFER HOLE 0.030 x 45°
 2. INSERT D2971 SPACER
 3. WELD INTO PLACE AND GRIND FLUSH
 4. PASS Ø0.750 DRILL TO REMOVE SPILL OVER

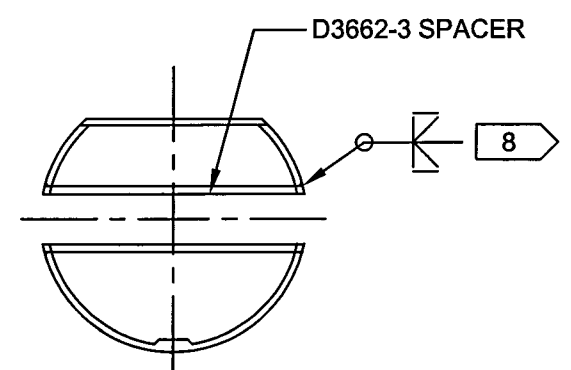


SECTION E-E
SCALE 4X

- SECTION E-E NOTES**
AFTER BENDING AND DRILLING ASSEMBLY
PERFORM THE FOLLOWING:
1. CHAMFER HOLE 0.030 x 45°
 2. INSERT D3662-3 SPACER
 3. WELD INTO PLACE AND GRIND FLUSH
 4. PASS Ø0.672 DRILL TO REMOVE SPILL OVER

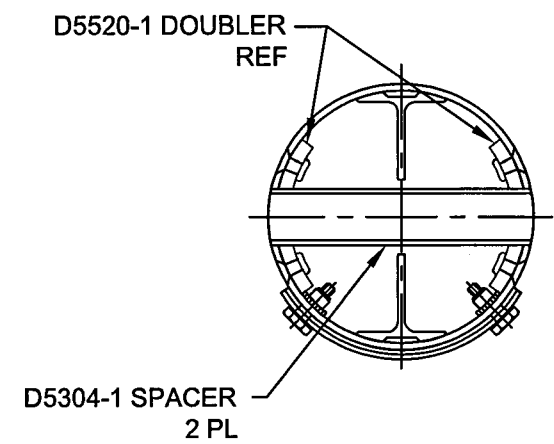


SECTION F-F
SCALE 4X
2 PL
E

- SECTION F-F NOTES**
AFTER BENDING AND DRILLING ASSY
PERFORM THE FOLLOWING:
1. INSERT D5304-1 SPACER
 2. SWAGE TO Ø0.565 +0.005/-0.000 X 1.0 DEEP PER QSI 002
 3. OPEN THRU HOLE TO Ø0.625
 4. GRIND FLUSH

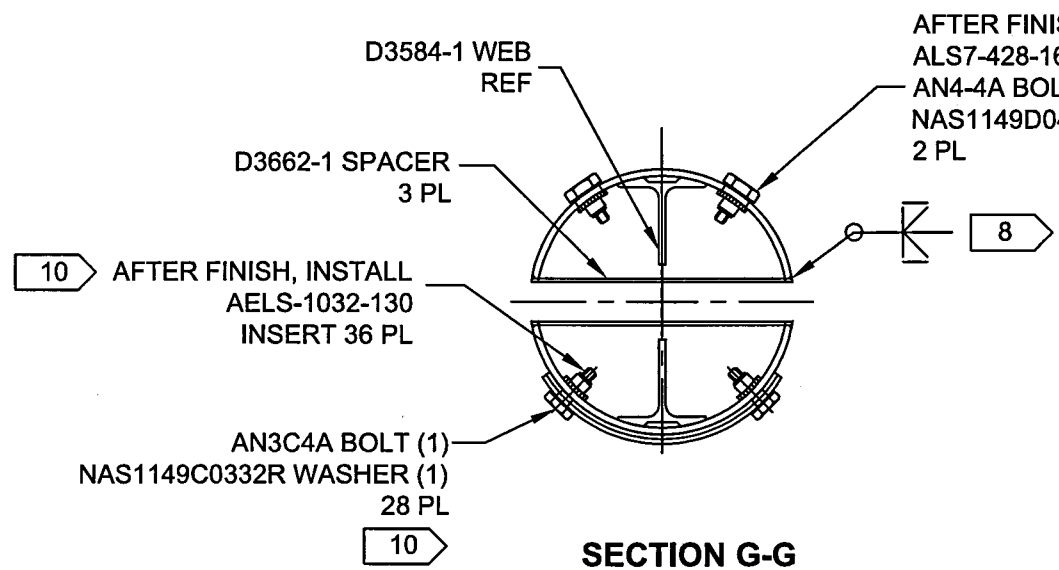

SECTION G-G
SCALE 4X

- SECTION G-G NOTES**
AFTER BENDING AND DRILLING ASSEMBLY
PERFORM THE FOLLOWING:
1. CHAMFER HOLE 0.030 x 45°
 2. INSERT D3662-1 SPACER (3 PLACES)
 3. WELD INTO PLACE AND GRIND FLUSH
 4. PASS Ø0.515 DRILL TO REMOVE SPILL OVER

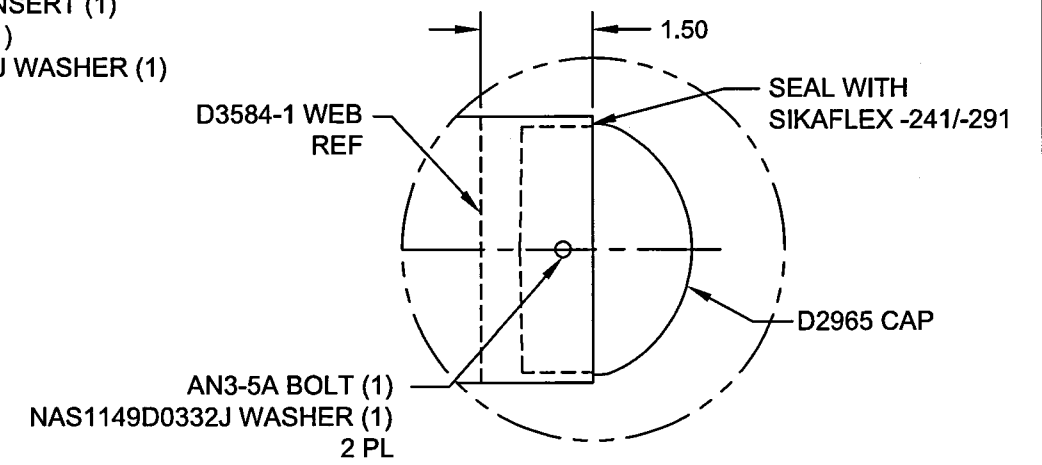


DETAIL H
SCALE 4X
9

RELEASED
2017-08-11

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	EUGENE, OR	
CHECKED	<i>mLee</i>	DRAWING NO.	REV. E
MFG. APPR.	<i>DP</i>	D3582	SHEET 3 OF 4
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	BK 117 SKIDTUBE ASSEMBLY	NTS
DATE	17.03.27	COPYRIGHT © 2007 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

8 7 6 5 4 3 2 1

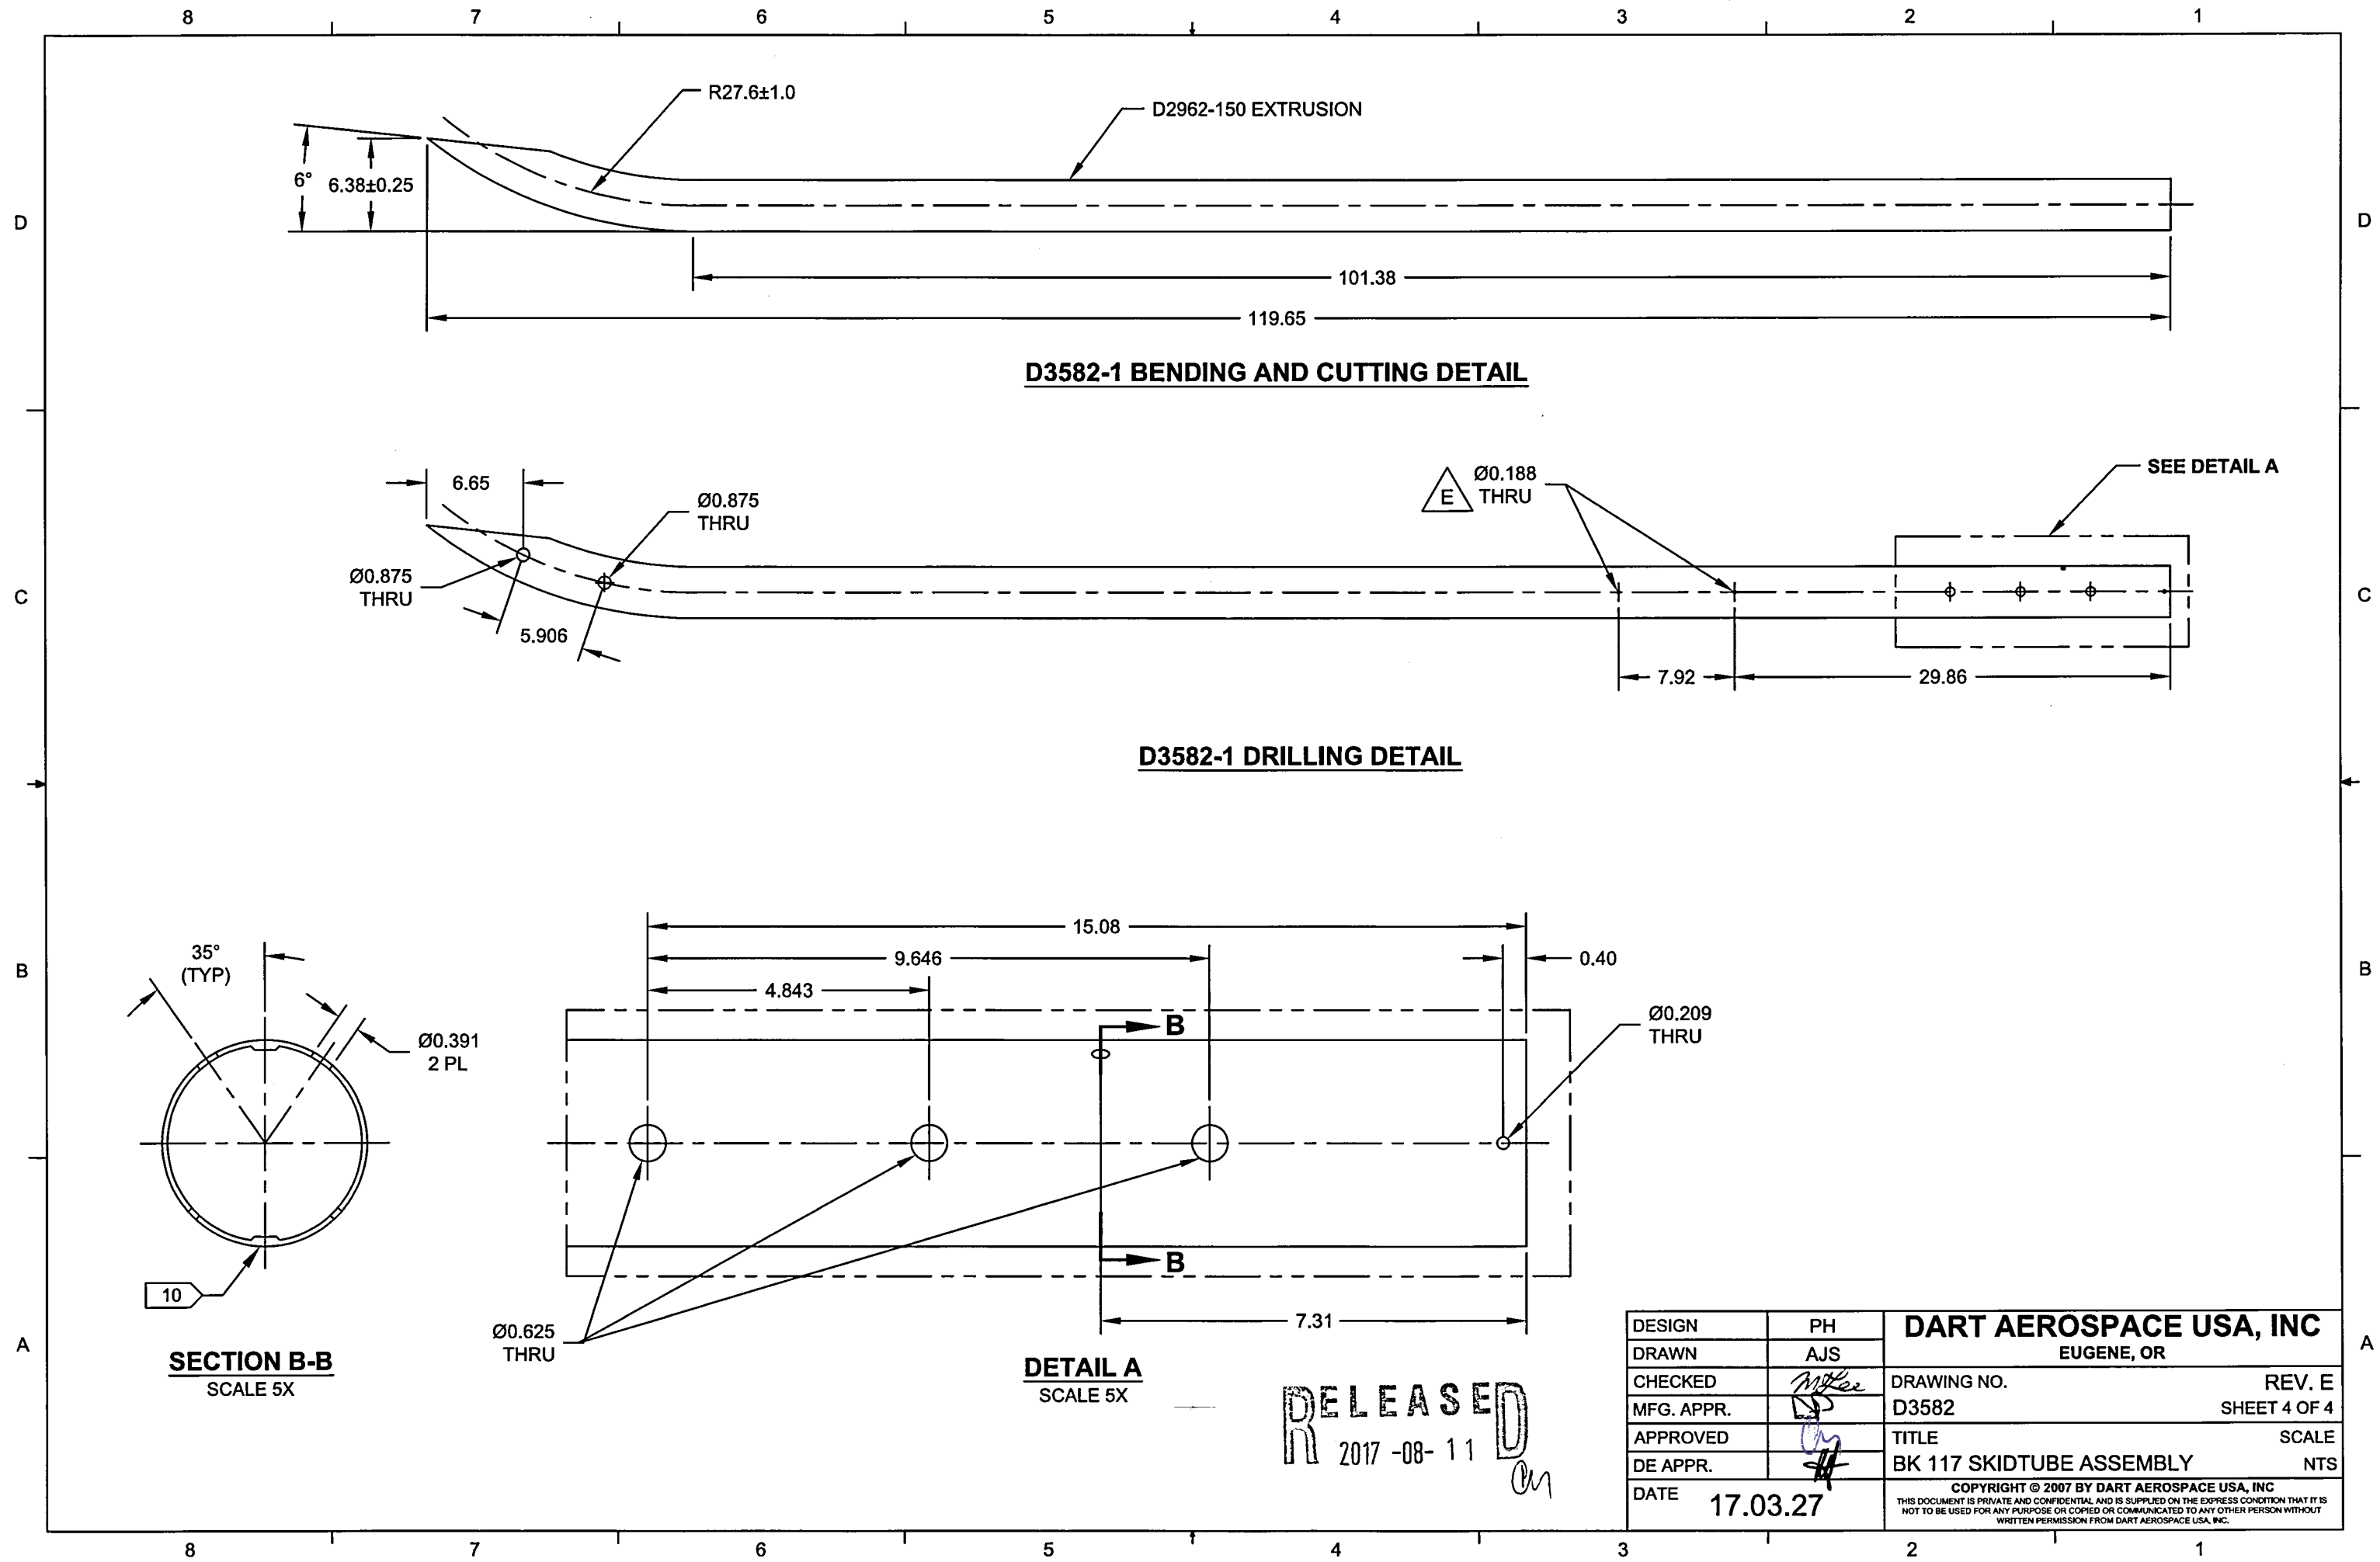

RELEASED
2017-08-11

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	AJS	EUGENE, OR	
CHECKED	<i>M. Lee</i>	DRAWING NO.	REV. E
MFG. APPR.	<i>DS</i>	D3582	SHEET 4 OF 4
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	BK 117 SKIDTUBE ASSEMBLY	NTS
DATE	17.03.27	COPYRIGHT © 2007 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	